



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200

D119-646-041
Job Sheet 168935



Part No: D119-646-041

Job Qty: 1 pcs

Part Name: AW119 Replacement Skidtube with Wearpads - Fits LH or RH



Part Weight: 0 lbs

Status: Scheduled

Priority: High

Job Created: 11/27/17

Job Tracking No:

Due Date: 12/8/17

Created By: Mario Poulin

Type: SOLD

Description:

Note: DWG IIN-D119-646 REV D, D3887-041 REV E SHEETS 1,2,5,7,8,10,11 IPP RevA: New issue DD verified by:EC IPP rev B 10.02.22 per PAR 09-043 EC verified by:DD IPP REVC 12.11.05 (DEOD3887-B-1)(ecn 12-675) DD verf:JLM IPP REV:D 13.03.20 per chg003 ECN13-534 DD verf:JLM IPP REV:E 17.05.19 as per dwg D3887 rev.e DD verf:JFS

Ship Via:

Bill of Materials

Job Routing

Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea	12/7/17	12/7/17	0.00	0.00	Start Up Skidtubes		
110	Skidtubes	1 pcs	12/7/17	12/7/17	0.00	0.25	Skidtubes		5.7
120	HandFinish	1 pcs	12/7/17	12/7/17	0.00	0.83	HandFinish1		2017-12-05 JSL
121	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC7		BE
122	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC5		BE
130	Skidtubes	1 pcs	12/7/17	12/7/17	0.00	1.54	Skidtubes		5.7
135	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC5		BE
140	Skidtubes	1 pcs	12/7/17	12/7/17	0.00	1.47	Skidtubes		
150	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC5		
160	Skidtubes	1 pcs	12/7/17	12/7/17	0.00	1.61	Skidtubes		
170	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC5		
180	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC10		
190	HandFinish	1 pcs	12/7/17	12/7/17	0.00	0.83	HandFinish2		
200	Powdercoat	1 pcs	12/7/17	12/7/17	0.00	0.22	Powdercoat1		
210	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC3		
220	HandFinish	1 pcs	12/7/17	12/7/17	0.00	3.83	HandFinish4		
230	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC5		
240	HandFinish	1 pcs	12/7/17	12/7/17	0.00	1.43	HandFinish4		
245	QC	1 pcs	12/7/17	12/7/17	0.00	0.00	QC5		
250	HandFinish	1 pcs	12/8/17	12/8/17	0.00	0.33	HandFinish3		
251	QC	1 pcs	12/8/17	12/8/17	0.00	0.00	QC5		
255	DC	1 pcs	12/8/17	12/8/17	0.00	0.00	DC		
260	Packaging	1 pcs	12/8/17	12/8/17	0.00	0.00	Packaging3		
270	QC21-FG	1 Ea	12/8/17	12/8/17	0.00	0.00	QC21		
310	Powdercoat	1 pcs	12/8/17	12/8/17	0.00	0.00	Powdercoat1		

Part Op 110 - 1- inspect Mat'L D2500-1-190 for damage 2-Cut tube to length as per dwg D3887 (154.8") 3- Ensure squareness of Descriptions: ends and scribe batch#

130 - 1- Install drill Jig DT9477 drill X-bolt spacer pilot holes using 3/16" drill first side only. 2- 2nd side, locating from first saddle holes use DT9861 A/B to drill 2nd side fwd saddle holes. 3- 2nd side locating from fwd saddle drill remaining crossbolt spacer holes usin DT9477 4- Open crossbolt spacer holes to finished size as per dwg D3887 (section D-D and E-E) ***DO NOT OPEN FWD Saddles Holes*** 5- Deburr, blow out chips from inside of tube. 6- Bond web in place as per Dwg D3887 & QSI 015. A/R

Sika-flex & M130654

EXP: 2018-04-21

Plex 11/27/17 8:55 AM dart.poulin.mario

DART
AEROSPACE
S016136

Dart Aerospace Ltd.
1270 Aberdeen Street
Hawkesbury, ON K64 1K7
CANADA
TEL.: 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com



AW119 Replacement Skidtube with Wearpads – Fits LH or RH

PART NO: D119 – 646 – 041

Revision:

Operation: Start up Operation

Change No:

Mfg Date: 11/30/17

Job No: 168935

140 - 1- Bend FWD end of tube using bender 1 and FOLIO 31 bend prog. D3887.***Must use bending aid DT9544, ensure proper positioning*** 2- Cut FWD end of tube as per dwg D3887.***Verify measurment*** 3- Buff out marks left from bending 4- Drill FWD cap holes using DT8215. Open FWD & AFT cap holes to 0.208" 5- Open FWD saddle holes to finished size as per dwg D3887 6- Drill FWD x-bolt spacer holes using DT9816 and open to finished size.(verify measurement) 7- Drill Tow ring hole, using DT10047 locate from FWD saddle hole. (verify measurement). Open to finished size. 8- Drill 1.87" and 3.74 holes using DT10045 A&B locate from FWD saddle hole. (verify measurement) as per dwg. 9- C'sink FWD cap hole as per detail "C" 10- Drill holes for wearpads using DT8931, open to 0.297". 11- Countersink crossbolt spacer holes, and prepare tube for welding, deburr. 12- Deburr and blow out chips from inside of tube.

160 - NOTE:TACK IN 2 MOST FWD X-BOLT SPACERS AND TEST FIT FWD GROUND HANDELING FIXTURE,IF FIXTURE FITS WELL THEN PROCEED. FIXTURE DT10091. 1-Insert crossbolt spacers. Weld as per QSI 004 and Dwg D3887. Remember to back drill each hole before welding the other side. Use aluminum rod A/R 2-Grind cross bolt welds flush as per Dwg D3887. Ensure no pin hole. 3-Counterbore 5/16" x 0.750" deep as per Dwg D3887. 4- Deburr & Scribe batch # on Aft end of tube.

170 - TEST FIT USING FIXTURE DT10091.

190 - Re-alodine tube as per QSI 005 section 4.1.2.1 do not acid etch.

200 - START TIME: _____ FINISH TIME: _____

220 - 1-Install inserts as per Dwg D3887.

240 - 1-Install wearpads, gaskets as per Dwg D3887. Put sikaflex in insert before installing bolts and washers

255 - Photocopy bluefile & type labels per PPP D119-646-041 CHG004


Job Allocations

Operation	Component Part	Required	Inventory	Allocated	Std Qty
90-Start up Operation	D2500-1-190 159217	1	51	0	0
140-Skidtubes	D2579	2	41	0	0
	D3885-1 162925	1	30	0	0
160-Skidtubes	D2855-5	1	128	0	0
	D3681-1	12	111	0	0
	D3903-1	12	143	0	0
230-QC	ALS4-1032-130	33	11,988	0	0
240-HandFinish	ALS4-1032-225	1	1,836	0	0
	AN3C4A	6	993	0	0
	AN3C5A	26	280	0	0
	D2855-3	1	28	0	0
	D3492-5	24	155	0	0
	D3672-1	2	1,741	0	0
	D3847-1	5	30	0	0
	D3847-11	1	24	0	0
	MS24694-C52	2	170	0	0
	NAS1149C0332R	32	3,215	0	0
	NAS1611-005	24	820	0	0

Part Specifications

Specifications could not be found.

8 7 6 5 4 3 2 1

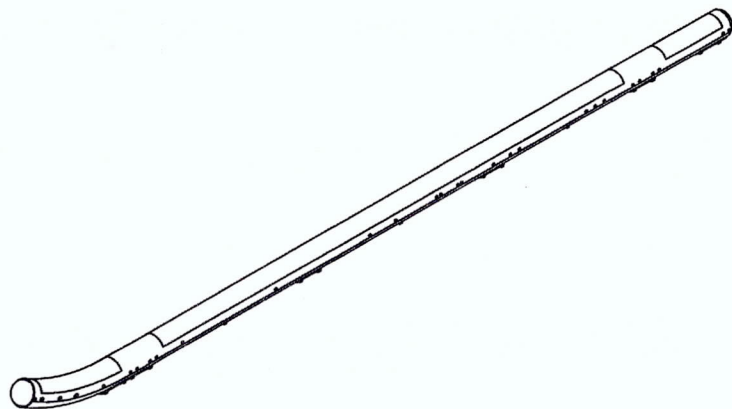

D3887-041 STANDARD SKIDTUBE ASSY WITH WEARPAD(SHOWN)
D3887-043 STANDARD SKIDTUBE ASSY WITH WEARPLATE (SIMILAR)
D3887-045 STANDARD SKIDTUBE ASSY WITH TRAINING WEARPLATE (SIMILAR)

E	COMPLETE REDRAW, ADDED ASSY DETAILS -3, -051 & -053, SEE PREVIOUS REV. FOR DETAIL. POWDER COAT REMOVED FROM SADDLE AREA SEE DETAIL F, REF PAR15-421. ADDED STRUCTURAL PROVISIONS TO ALLOW FOR THE INSTALLATION OF THE D119-846-313/314 SKIDTUBE PROTECTOR KIT, REF PAR17-577. CHANGE QTY OF D2855-3, ADDED D2855-5 CAP ASSEMBLIES, ADDED INSTRUCTIONS TO LOCATE INSERT HOLE FOR D2855-5 CAP, REF PAR17-583.	AJS / WK	17.02.03
D	REVISED BEND TOLERANCES FOR MANUFACTURABILITY, 135.07 WAS 134.04 (ZN D5-8), ADD 5.07 (ZN C2-8), ADD 116.8 (ZN D5-8), DELETE GASKETS (BOM, SH 2)	DB	13.09.20
C	(SHT1, P/L, ZN C2-2, C3-2, C4-2) ITEM 13, QTY 2 WAS 4, ITEM 42, QTY 32 WAS 34, ITEM 44, QTY 30 WAS 32, ADD ITEM 46, MS24694-C52 WAS AN3C5A, 2 PLCS (ZN C1-5, C1-6, B4-7) 0.0201 CSK 0.0385 X 100" WAS 0.0214 THRU, ADDED DETAIL F (ZN C8-5, C8-6, B8-7), ADD ITEM 10, D2579 CROSS BOLT SPACER (ZN D4-1, A6-7)	DB	13.02.19
B	ALS4-1032-130 WAS AELS-1032-130 (ZN C4-1, C5-7, C3-7); ADD DT8931 (ZN A6-1); ADD 134.04 (ZN C4-8); D2855-3 WAS D2575 (ZN D4-1, C7-2, C2-2, C7-3, C2-3, C7-4, C2-4); AN3C5A WAS AN3C4A (ZN C6-2, C2-2, C6-3, C2-3, C6-4, C2-4); 0.0313 WAS 0.0328 (ZN C4-5, C4-5, C2-7 & B3-7) REVISED NOTE iv (ZN B3-7)	RF	09.06.30
A	NEW ISSUE	RF	09.03.30
REV.	DESCRIPTION	BY	DATE
DESIGN	RF	DART AEROSPACE USA, INC. EUGENE, OR	
DRAWN	WK		
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 1 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL, AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

RELEASED
 2017-05-08
 17-519

8 7 6 5 4 3 2 1

D

NOTES:



2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 2 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2000 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSES, OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT THE WRITTEN PERMISSION OF DART AEROSPACE USA, INC.	

COPYRIGHT © 2008 BY DART AEROSPACE USA, INC.
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT
NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT
WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

ITEM	QTY -043	P/N	DESCRIPTION
	X	D3887-043	STANDARD SKIDTUBE ASSY WITH WEARPLATE
1	1	D2855-3	CAP ASSY
2	1	D2855-5	CAP ASSY
3	24	D3492-045	PLUG ASSY
4	2	D3672-1	PHENOLIC WASHER
5	1	D3847-043	FWD WEARPLATE ASSY
6	1	D3847-045	CENTER WEARPLATE ASSY
7	1	D3847-047	AFT WEARPLATE ASSY
8	5	D3847-1	WEARPAD
9	1	D3847-11	WEARPAD
10	1	D3887-051	SKIDTUBE ASSY
11	1	ALS4-1032-225	INSERT
12	32	AN3C5A	BOLT
13	2	MS24694-C52	SCREW, CSK 100°
14	32	NAS1149C0332R	WASHER

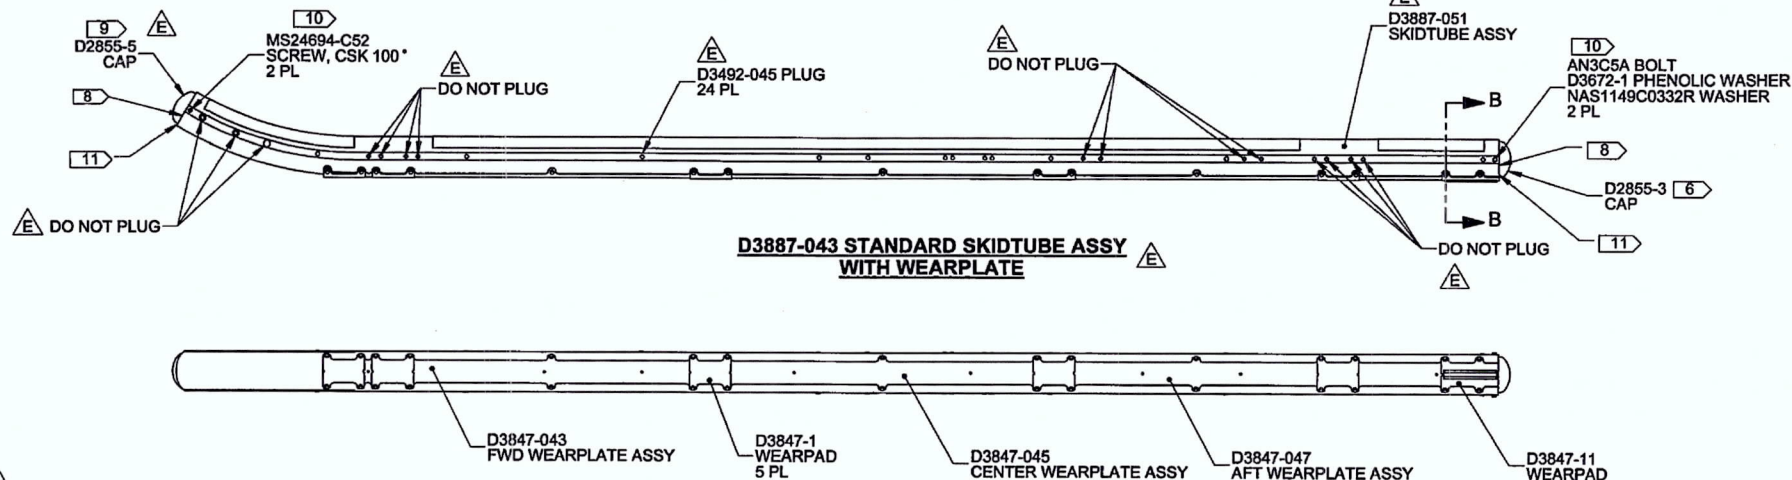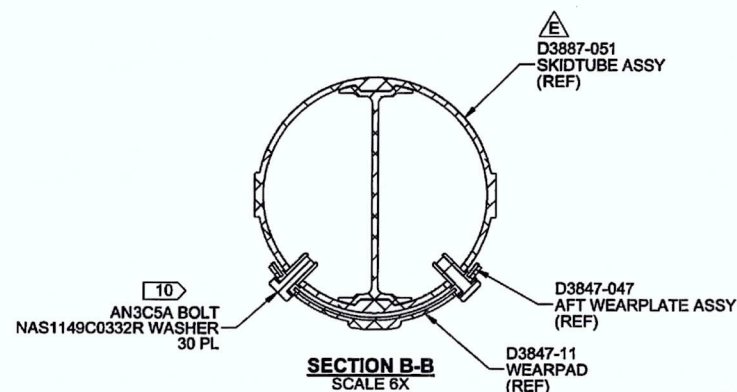

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY WITH DART P/N "D3887-043" AND BATCH NUMBER PER QSI 044 6.4 ON THE ID OF THE TUBE, BEFORE INSTALLING THE AFT D2855-3 CAP
- 7) WEIGHT: 37.0 lbs
- 8) RELIEVE INNER RIDGE OF EXTRUSION, AS NEEDED, TO ALLOW FOR INSTALLATION OF D2855-3 AND D2855-5 CAP ASSY, ALODINE BARE MATERIAL
- 9) USE D3887-051 SKIDTUBE ASSY TO LOCATE AND BACKDRILL UNDRILLED INSERT HOLE INTO D2855-5 CAP. OPEN HOLE TO Ø0.297, ALODINE BARE MATERIAL AND INSTALL ALS4-1032-225 (OR AKS7-1032-225, OR ALS7-1032-225, OR AKS4-1032-225) INSERT ON INSIDE OF CAP.
- 10) SEAL FASTENERS WITH SIKAFLEX -241/-291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT
- 11) SEAL MATING SURFACES WITH SIKAFLEX -241/291 OR PROSEAL 890 OR MIL-S-8802 CLASS B2 SEALANT

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 3 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

D

C



B




A

THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AIRCRAFT USA, INC.

WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.

ITEM	QTY -051	P/N	DESCRIPTION
	X	D3887-051	SKIDTUBE ASSY
1	2	D2579	CROSS BOLT SPACER
2	12	D3681-1	CROSS BOLT SPACER
3	1	D3885-1	STANDARD WEB
4	1	D3887-11	SKIDTUBE
5	12	D3903-1	CROSS BOLT SPACER
6	30	ALS4-1032-130	INSERT

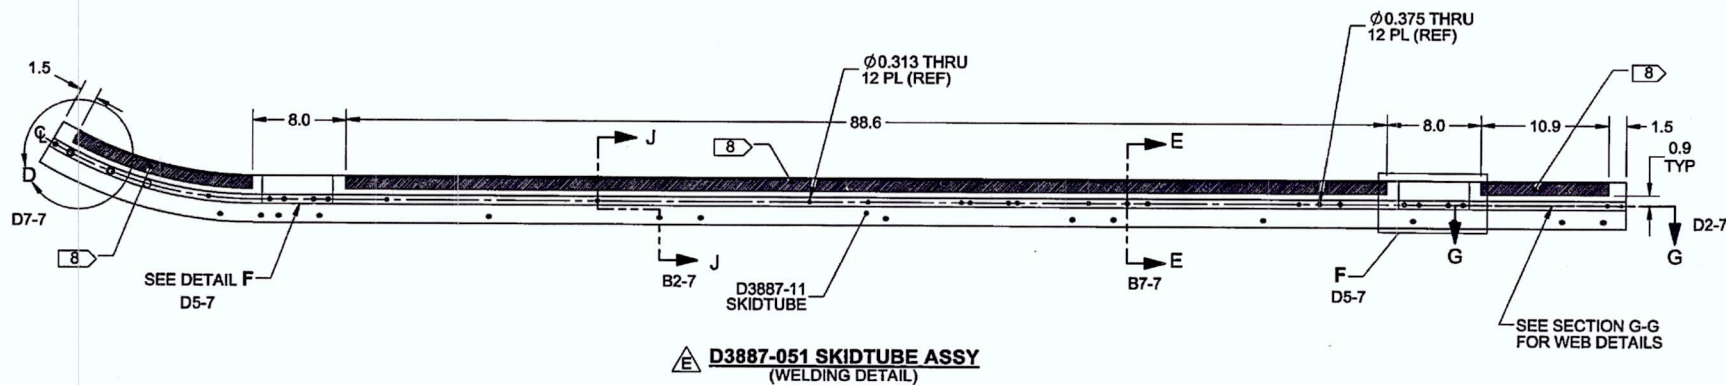

D3887-051 SKIDTUBE ASSY
(WELDING DETAIL)


NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: N/A
- 6) IDENTIFICATION: IDENTIFY AT NEXT ASSEMBLY
- 7) WEIGHT: N/A
- 8) AFTER APPLICATION OF FINISH, PAINT TOP SURFACE OF SKIDTUBE WITH MIL-W-5044 ANTI-SKID PAINT (WING WALK) AS INDICATED TO 0.50 ABOVE LOCATION RIDGE, PER QSI 005 SECTION 4.4

RELEASED
2017-05-08


APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 5 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

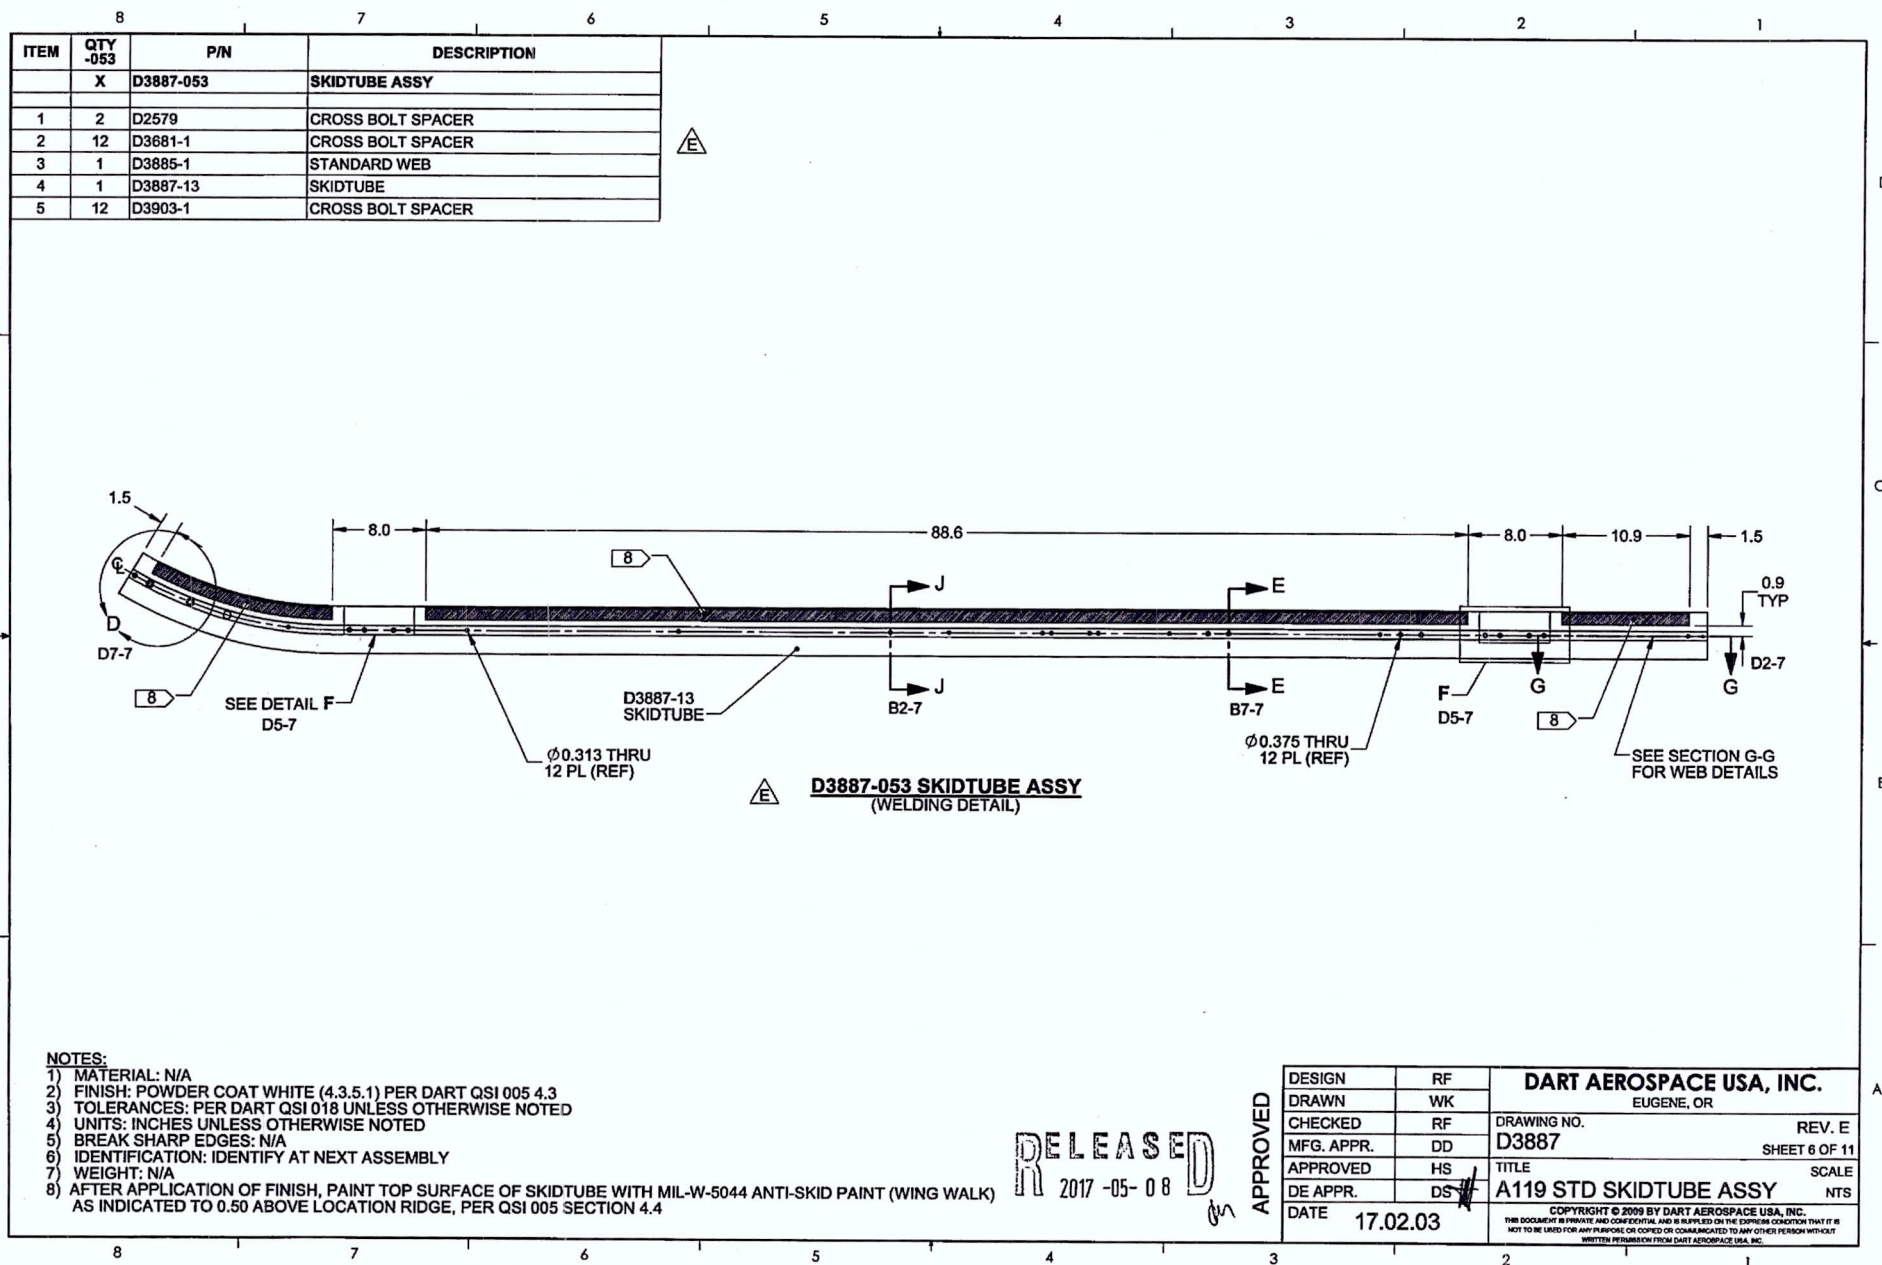


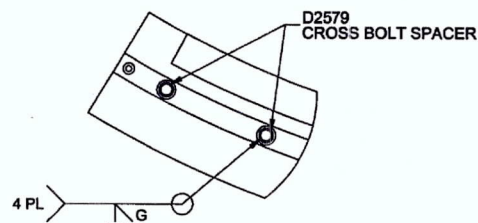


DETAIL D
SCALE 2X
TYP

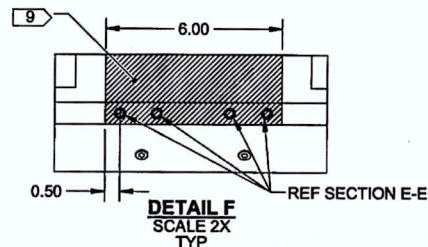

DETAIL F
SCALE 2X
TYP

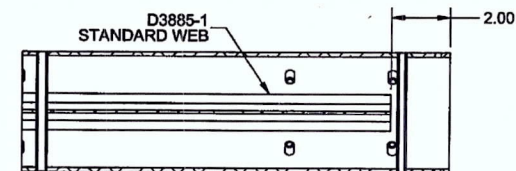


SECTION G-G
SCALE 2X
TYP

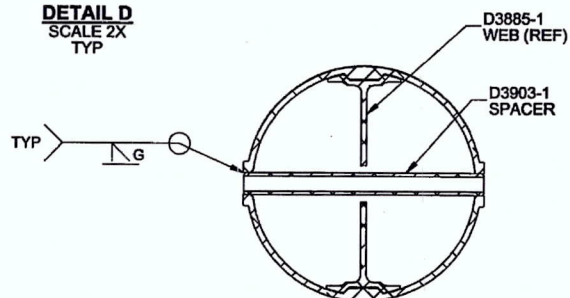

SECTION E-E
SCALE 5X
TYP

(FOR 12X $\phi 0.375$ HOLES
PER SKIDTUBE)

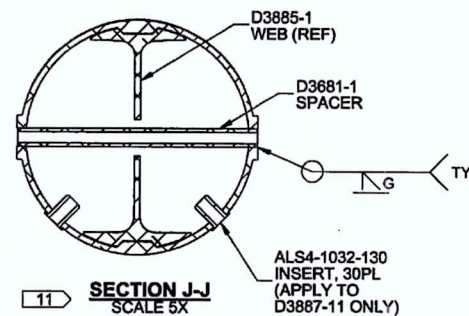

SECTION J-J
SCALE 5X
TYP

(FOR 12X $\phi 0.313$ HOLES
PER SKIDTUBE)


NOTES:


- 1) MATERIAL: N/A
- 2) FINISH: NONE
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) INSERT D3885-1 WEB TO LOCATION SHOWN OFF AFT END OF SKIDTUBE AND BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015 AFTER BENDING. ENSURE HOLES LINE-UP
- 9) MASK THIS AREA AND DO NOT POWDER COAT
- 10) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION E-E $\phi 0.375$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.475 \times 45^\circ$
 - ii) INSERT D3903-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) C'BORE TO $\phi 0.313 \times 0.75$ DEEP
 - v) DEBURR HOLES
- 11) AFTER DRILLING AND BENDING ASSEMBLY, PERFORM THE FOLLOWING FOR THE SECTION J-J $\phi 0.313$ HOLES ONLY:
 - i) CHAMFER HOLES $\phi 0.354 \times 45^\circ$ OR 0.050 DEEP $\times 45^\circ$ (BOTH SIDES)
 - ii) INSERT D3681-1 SPACER
 - iii) WELD INTO PLACE AND GRIND FLUSH
 - iv) DEBURR HOLES
- 12) WELD PER DART QSI 004

RELEASED
2017-05-08



APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 7 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

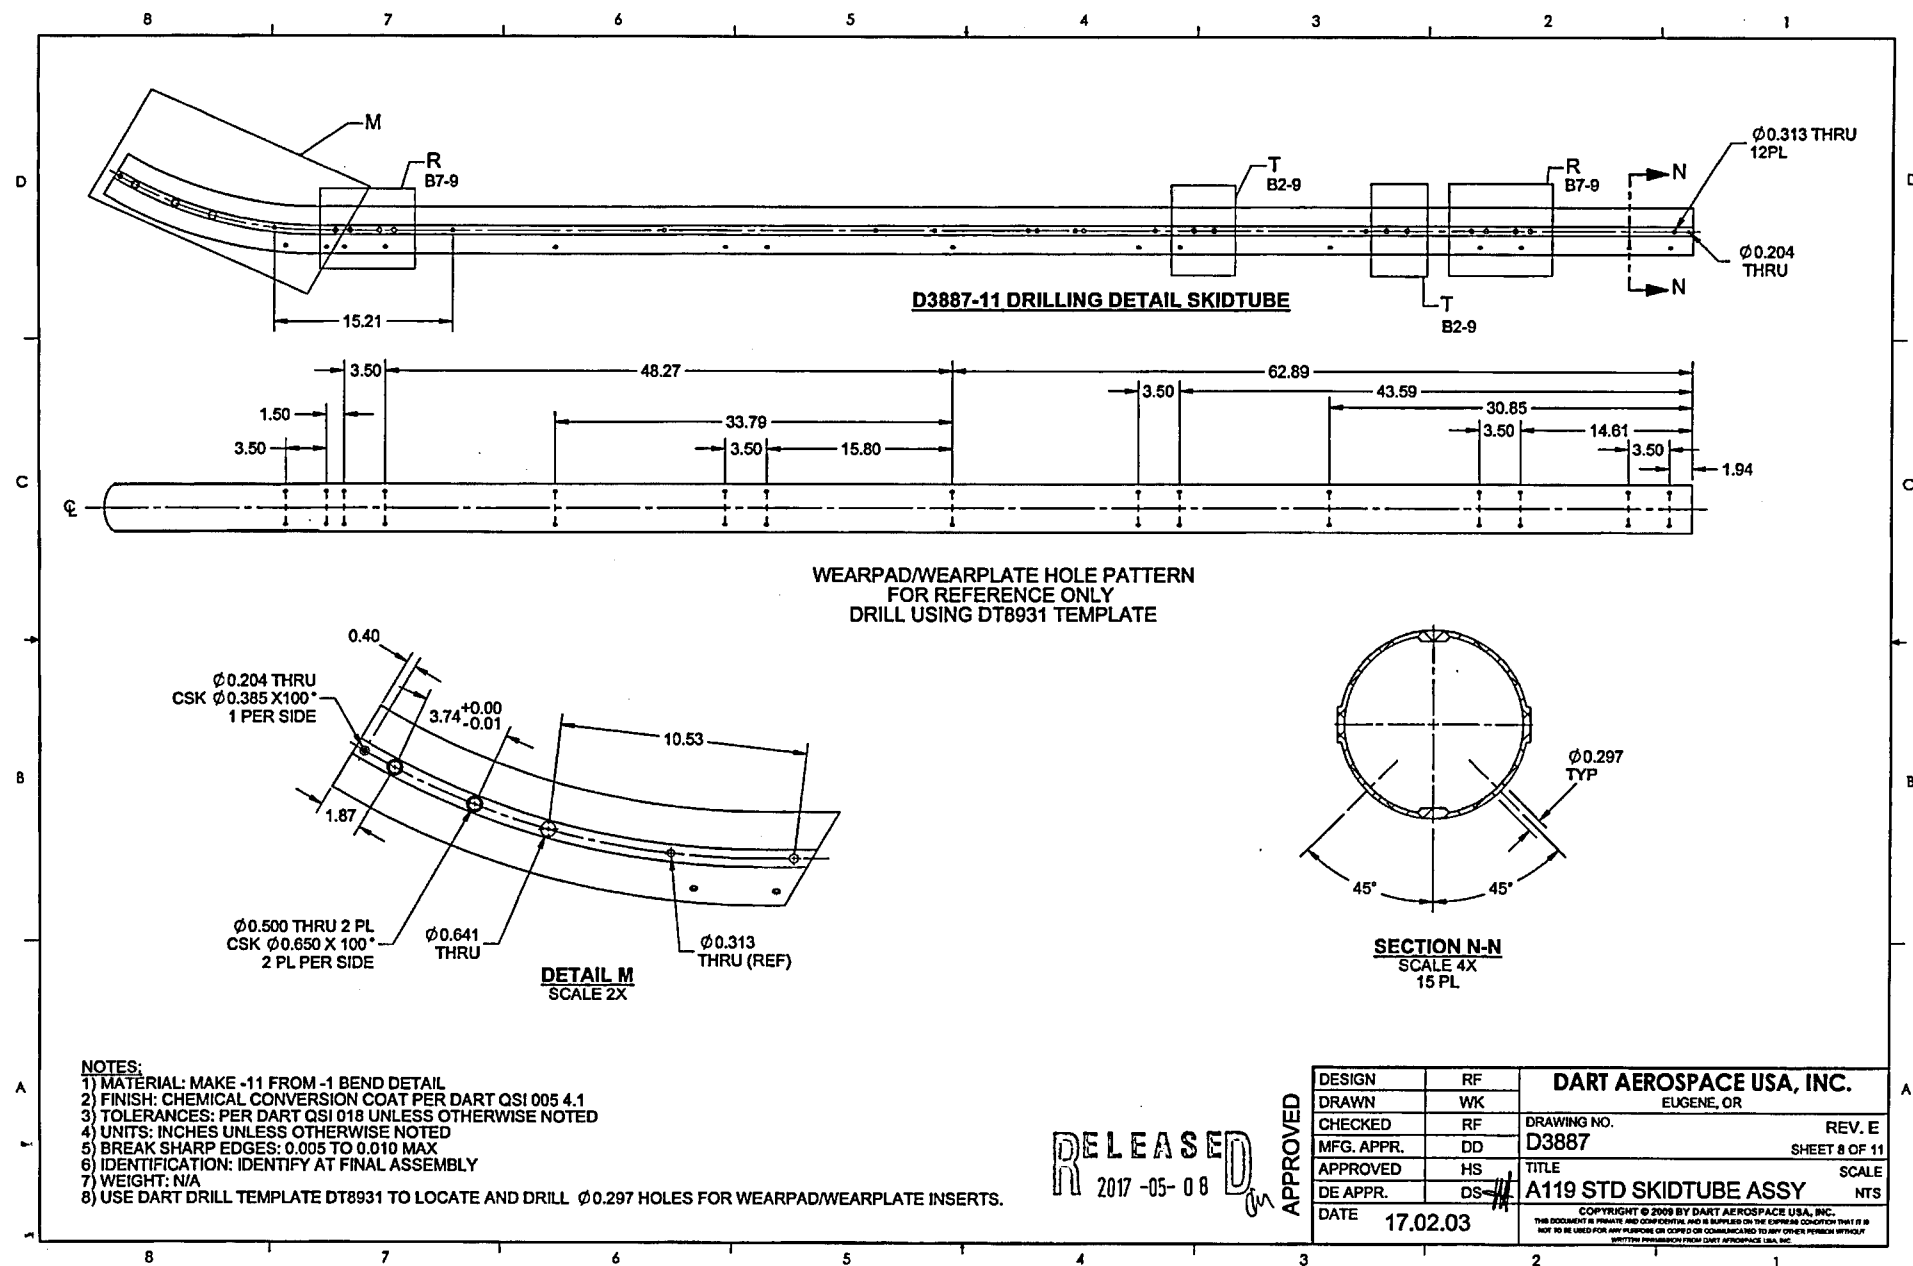

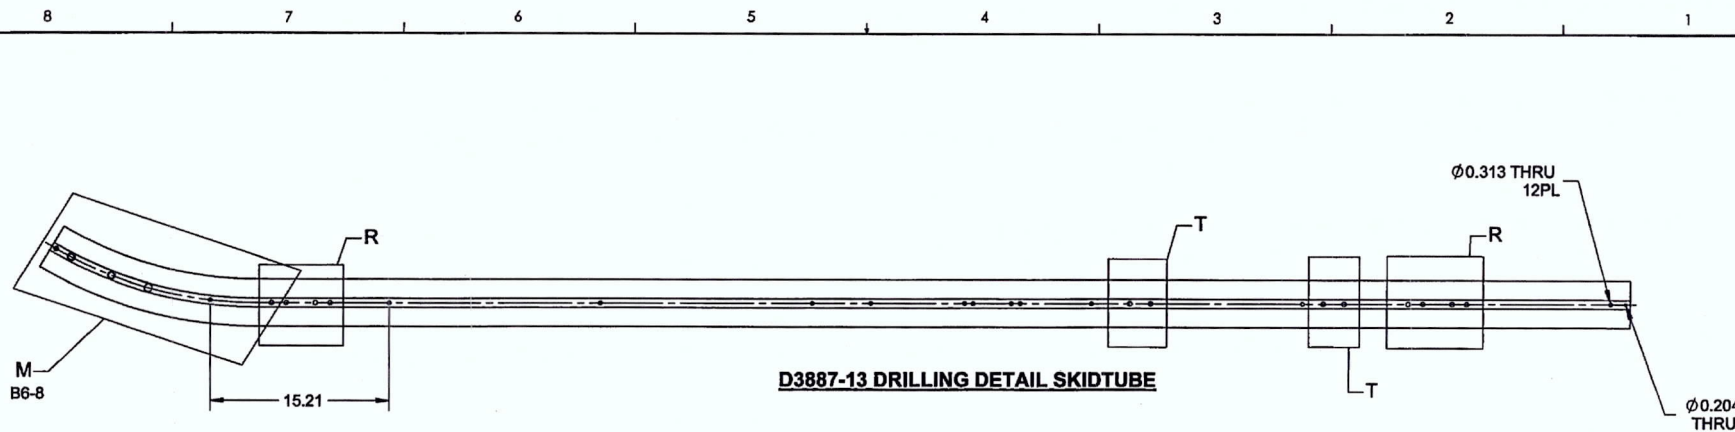

D3887-13 DRILLING DETAIL SKIDTUBE

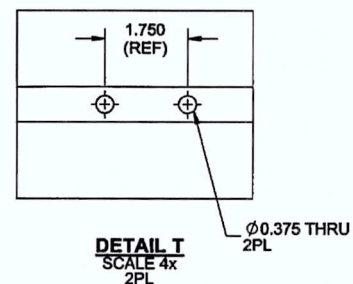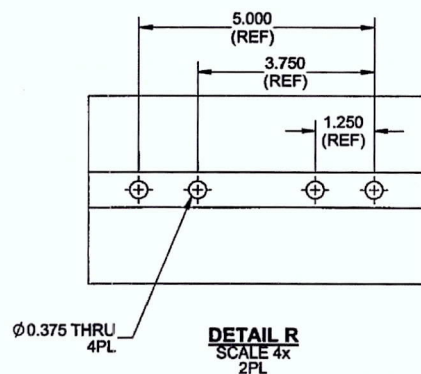


NOTES:

- 1) MATERIAL: MAKE -13 FROM -1 BEND DETAIL
- 2) FINISH: CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 9 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

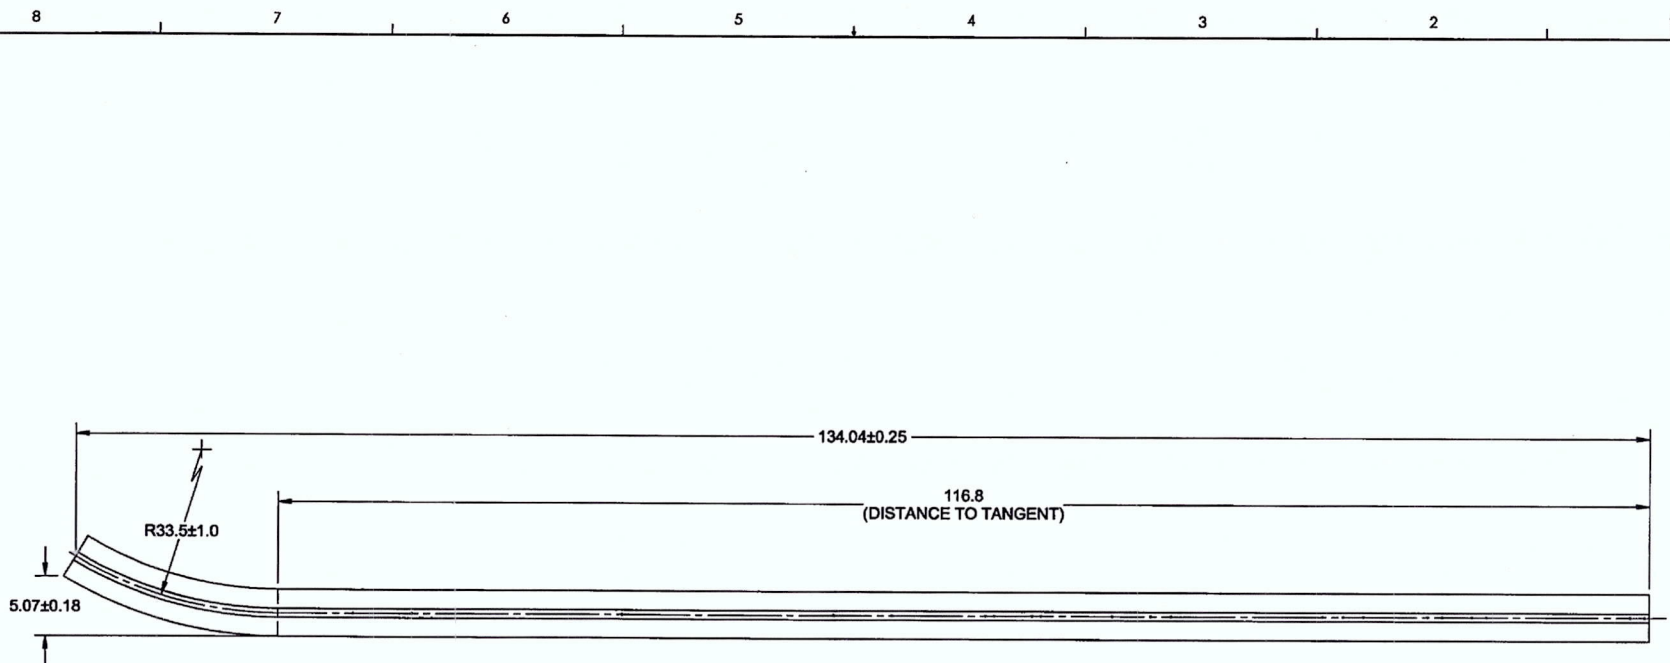

D3887-1 BEND DETAIL SKIDTUBE

NOTES:

- 1) MATERIAL: MAKE -1 BEND DETAIL FROM -3 PILOT HOLE DETAIL
- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A
- 8) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 8.5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020" DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 10 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC.	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

8 7 6 5 4 3 2 1

D

D

C


C

B


B

A


A

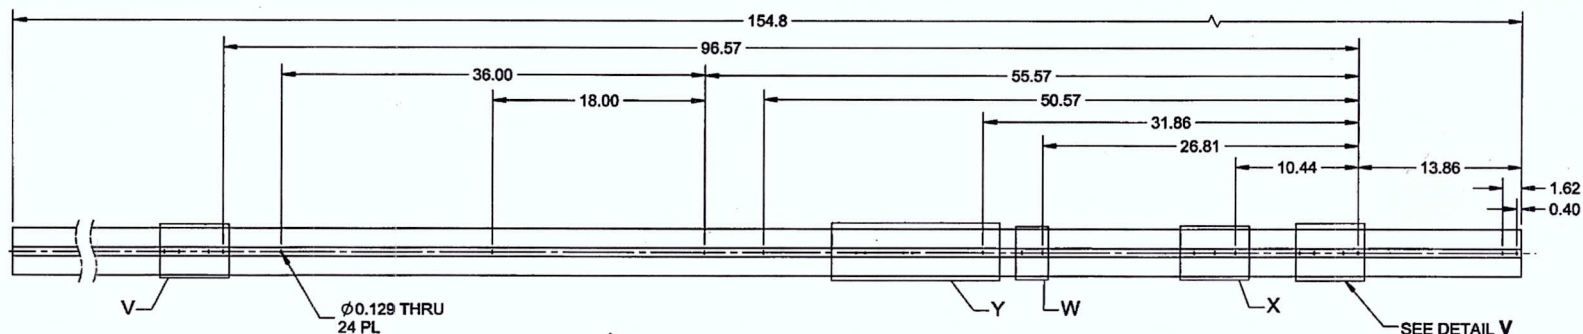


D3887-3 PILOT HOLE DETAIL SKIDTUBE

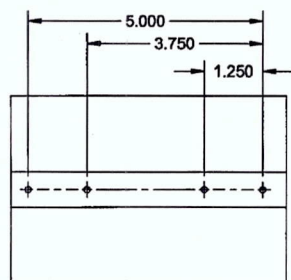


DETAIL V
SCALE 4X
2 PL

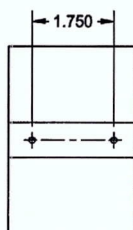

DETAIL W
SCALE 4X

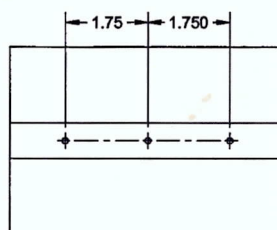

DETAIL X
SCALE 4X

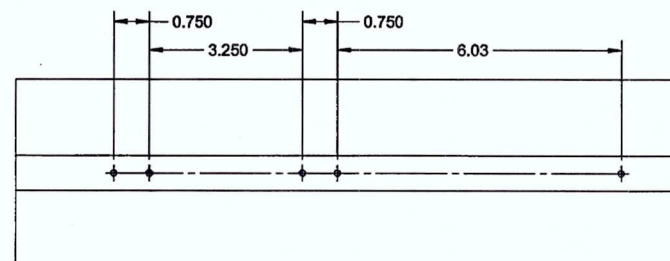

DETAIL Y
SCALE 4X

NOTES:

- 1) MATERIAL: MAKE FROM D2500-1-190 EXTRUSION
- 2) FINISH: N/A
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: IDENTIFY AT FINAL ASSEMBLY
- 7) WEIGHT: N/A

RELEASED
2017-05-08

APPROVED

DESIGN	RF	DART AEROSPACE USA, INC.	
DRAWN	WK	EUGENE, OR	
CHECKED	RF	DRAWING NO.	REV. E
MFG. APPR.	DD	D3887	SHEET 11 OF 11
APPROVED	HS	TITLE	SCALE
DE APPR.	DS	A119 STD SKIDTUBE ASSY	NTS
DATE	17.02.03	COPYRIGHT © 2009 BY DART AEROSPACE USA, INC. THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

8 7 6 5 4 3 2 1

DQA: _____ Date: _____



WORK ORDER NON-CONFORMANCE / UPDATE

QA Closed: _____ Date: _____

Work Order update only ☐

Work Order: <u>168935</u> Part No. <u>D119-646-041</u> NCR No. _____		DISPOSITION Rework ☐ Scrap ☒ Use-as-is ☐ Suspected Unapproved ☐		AGAINST DEPARTMENT/PROCESS							
				Skid-tube ☒ Machining ☐ Thermoforming ☐ Large Fab ☐	Cross tube ☐ Small Fab ☐ Finishing ☐ Composite ☐	Water Jet ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Supplier ☐	Engineering ☐ Quality ☐ Other ☐				
Date : _____		Step #: <u>140</u>		QTY Effective : <u>1</u>			MRB (QSI042) Approval				
Description Work Order Deviation				Disposition							
<u>Tube bent with kink During Program</u> <u>Adjustment following replacement of</u> <u>Bender Components</u>				<u>Scrap</u>							
								Completed By <u>Lg</u> <u>18-05-14</u>			
								Lead hand / Supervisor Approval Verification <u>NTW</u> <u>18-05-14</u>			
								QC / QA Coordinator Approval <u>DAS</u> <u>9</u> <u>9-89</u> <u>1805-14</u>			
Root Cause				FAULT CATEGORY							
Environment ☐ Design ☐ Doc/Data ☐ Equip/Tooling ☒ Handling/Pre ☐ Material ☐ Internal Transport ☐ Tribal Knowledge ☐ LOA ☐ Substation ☐ Past Expiry Date ☐ Misidentified ☐	No Re-verification ☐ Operator ☐ Offset/Setup ☐ Supplier ☐ Training ☐ Use for Testing ☐ Poor Information ☐ Rushing ☐ Product Improvement ☐ Process Improvement ☐ Manufacturing Process ☐ Past Due ☐	Pressure/Forced ☐ Bending ☐ Centre Not Concentric ☐ Cracks ☐ ☒ Crimp/Kink/Ripple/Wave Cuffs ☐ Crushing ☐ Heat Treat ☐ Wave/Twist in Tube ☐ Marks/Chatter ☐	Temperature/Cure ☐ Set-up ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Inspection Incomplete/Unqualified ☐ Contamination ☐ Countersink ☐ Cut Too Short ☐ Instructions Incomplete/Unclear ☐ Drill Holes ☐	Power Loss/Surge ☐ Folio/Program ☐ Grain ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set ☐ Misabeled ☐ Fit/Function ☐ Misaligned/off center ☐	Positioned Wrong ☐ Outside Dimensions ☐ Over/Under tolerance ☐ Part Incorrect ☐ Part Lost/Missing ☐ Part Moved ☐ Drawing ☐ Finish ☐ Misread ☐ Turning Sequence ☐						
OTHER : _____											